

Model: General RTB	Date: 26-Apr-11	No.: RGene044
--------------------	-----------------	---------------

Subject: New Bluetooth Option		Prepared by: N.Yoshida	
From: 1st Overseas Tech Support Sec., 1st PQM Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input checked="" type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input type="checkbox"/> Product Safety	<input type="checkbox"/> Other ( )	<input checked="" type="checkbox"/> Tier 2

**Important Information on the Release of the optional Bluetooth Interface Unit Type D**



**Model name: Bluetooth Interface Unite Type D**  
**Machine code: D566-01**  
**EDP code: 415818**

**Overview**

- In March 2011, production began on the **Bluetooth Interface Unit Type D**, a USB version of the existing CF card type. The changeover from the CF card type to USB type begins from the AT/AP-C2.5.
- To support the new option, the System Firmware was modified. For a list of the target models and supported System software for each, see the “Target Models, Firmware” table below.
- For the specifications of this option, see the Operating Instructions.

**Action in the field**

- Make sure the System firmware has been updated to the following versions or newer. Then, have the user do the procedure shown on the next page.
- Make sure to hand the customer all of the Operating Instructions (manuals) bundled together with the Bluetooth Interface Option.

**Target Models, Firmware**


	Model	Code	System firmware	Applied to the production line
01.	AP-C2.5	D088/D089	3.00	2011 March
02.	AT-C2.5	D086/D087	2.00	2011 March
03.	Z-C1	M022/M024/ M026/M028	2.00	2011 March
04.	Di-C1.5	D104/D106	2.00	2011 April
05.	Sh-MF1	M052/M053/M054	TBA	TBA

**Note:** If you do not update the System firmware to these versions or newer, the following error message will appear:  
 "Incompatible USB device has been connected. Check the USB device"

## Setting up the Bluetooth Interface Unit Type D

- 1) Turn off the main power of the MFP, and then unplug the power cable and the interface cable.
- 2) Insert the **Bluetooth Interface Unit Type D** into the USB port, as shown.

**Note:** You can use either USB port for this option.

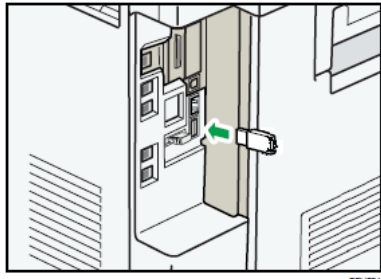

- 3) Turn on the main power of the MFP.
- 4) To begin printing with this option, follow the procedure described in the Operating Instructions ("Printing with Bluetooth Connection" in the *Operating Instructions* for Bluetooth Interface Unit).
- 5) Make sure that "Bluetooth: Up" is shown in the Interface Setting Print List [COMMON].  
**Note:** This is located in *User Tools – System Settings – Interface Settings – printList*.

### NOTE

1. The Bluetooth unit and optional wireless LAN unit cannot be used simultaneously.
2. The Bluetooth unit can only be connected to the USB port on the MFP itself. It will not work if connected to a USB hub, such as the optional SD/USB slot.
3. The SC853 or SC854 error will occur if you insert or remove the Bluetooth unit after the MFP main power has already been turned on.